


Description


IP66. Class I. IK08. Marine-grade, die-cast aluminium alloy. 5CE superior corrosion protection + primer including PCS hardware. Safety glass lens. Silicone CCG[®] Controlled Compression Gasket. Luminaire is factory-sealed and does not need to be opened during installation. Optional 2200 K version up to max. 1050mA available. To be specified at time of ordering.

Integral EC electronic converter. Advanced thermal management protects LEDs while optimising lumens output. CAD-optimised optics for superior illumination and glare control. OLC® One LED Concept.

Luminaire can be mounted for up or down lighting.

Weight	2.60 kg
Light distribution	rectangular, side throw [R45]
Light source	LED-6/18W / 1050 mA - 3000 K
CRI	80
Power supply	EC
BUG	B0 U0 G0
LEDs	6
Rated input power	21 W
Nominal Lumen (lm)	
LED Lumen	430
Total Lumen	2580
Tj	85
Rated lumens (lm)	
LED Lumen	256.7
Total Lumen	1540.2
Та	25

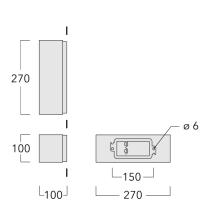

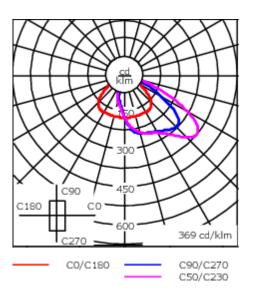

Specifications Material description

Body	Marine-grade, die-cast aluminium alloy	
Lens	Safety glass lens	
Colours	RAL9004 Signal black	
	RAL9006 White aluminium	
	RAL9007 Grey aluminium	
Gasket	Silicone CCG [®] Controlled Compression Gasket	
Fasteners	PCS Polymer Coated Stainless Steel Hardware	
Ingress protection	IP66	
Impact resistance	IK08	
Corrosion resistance	5CE+Primer	

Electrical description

Driver / Ballast Standard. Optional DALI version available. To be specified at time of ordering.

Additional information

Lifetime Ta=40° L90B10 > 90000h

131-9982

RLS420 LED

Control

1-10 V analogue dimming interface

Description	Part ID	С
1-10 V analogue dimming interface	430-0011	90

131-9982

RLS420 LED

DALI interface

Description	Part ID	Additional information	С
DALI interface	430-0013	DALI variant. The luminaire is equipped with a DT6 Dali driver (Dali 2.0).	90
		Dali 2.0	
	-Application controllers and Input devices defined		
		-Single-masters and multi-masters allowed	
		-Event priorities defined	
		-Separate addressing & grouping from control gear	
		Note: Mixing Dali 1 and Dali 2.0 drivers can cause problems because the addressing and the command scope has changed!	

RLS420 LED


Optical Accessories

Colour correction filter

Description	Part ID
IF-3000K > 2400K	131-9707

Honeycomb louvre

Description	Part ID
Honeycomb louvre IW	131-9706

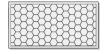

we-ef