



Weight

Description

IP65, Class I. IK07. Marine-grade, die-cast aluminium alloy. 5CE superior corrosion protection + primer including PCS hardware. Silicone CCG® Controlled Compression Gasket. Safety glass lens. Two cable entries. Integral EC electronic converter. CAD-optimised optics for superior illumination and glare control. OLC® One LED Concept. Factory installed LED circuit board. 1-10V or DALI interface on request. Optional 2200 K version available. To be specified at time of ordering.


Can be mounted up or down.


Light distribution	asymmetric, forward throw [A60]
Light source	LED-24/48W / 700 mA - 4000 K
CRI	80
Power supply	EC
LEDs	24
Rated input power	54 W
Nominal Lumen (lm)	
LED Lumen	310
Total Lumen	7440
Tj	85
Rated lumens (lm)	
LED Lumen	234.3
Total Lumen	5624
Та	25

11.40 kg

OLV344 LED



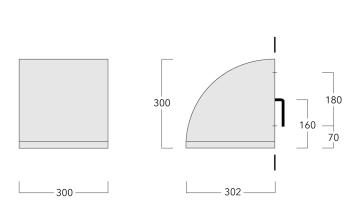

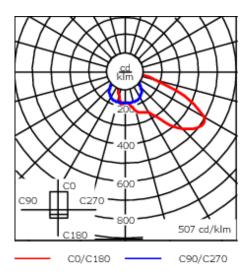

Specifications

Material description

Body Marine-grade die-cast aluminium alloy

Lens Safety glass lens

Colours RAL9004 Signal black

RAL9006 White aluminium
RAL9007 Grey aluminium

Gasket Silicone CCG® Controlled Compression Gasket

Fasteners PCS Polymer Coated Stainless Steel Hardware (unpainted)

Ingress protection IP65
Impact resistance IK07

Corrosion resistance 5CE+Primer

Electrical description

Power supply 230V / 50 Hz

Driver / Ballast Integral EC electronic converter

Additional information

Lifetime Ta=40° L90B10 > 90000h

Warranty The product is supplied with 10-year warranty. Please refer to the LED Warranty Statement

located on www.we-ef.com for further details.





Control

1-10 V analogue dimming interface

iption Part II	t ID C
V analogue dimming interface 430-0)-0011 9

132-0561





DALI interface

Description	Part ID	Additional information	С
DALI interface 430-0013	430-0013	DALI variant. The luminaire is equipped with a DT6 Dali driver (Dali 2.0).	90
	Dali 2.0 -Application controllers and Input devices defined -Single-masters and multi-masters allowed -Event priorities defined -Separate addressing & grouping from control gear		
		Note: Mixing Dali 1 and Dali 2.0 drivers can cause problems because the addressing and the command scope has changed!	g