FLC301 Space frame





Description

IP66. IK07. Marine-grade, die-cast aluminium alloy. 5CE superior corrosion protection + primer including PCS hardware. Safety glass lens. Silicone CCG® Controlled Compression Gasket. Luminaire is factory-sealed and does not need to be opened during installation.

Integral EC electronic converter in thermally-separated compartment. Advanced thermal management protects LEDs while optimising lumens output. CAD-optimised optics for superior illumination and glare control.


Including terminal box, for mounting on \emptyset 48-60 mm pipes or space frames.


Mains voltage versions only, ON-OFF Class I or DALI interface available on request (converter in thermally-separated compartment); refer to accessory listings.

Weight	1.70 kg
Light distribution	symmetric, wide beam [B]
Light source	LED-1/6W / 500 mA - 3000 K
CRI	80
Power supply	EC
LEDs	1
Rated input power	7.5 W
Rated lumens (lm)	
LED Lumen	518.4
Total Lumen	518.4
Та	25
Nominal Lumen (lm)	
LED Lumen	670
Total Lumen	670
Тс	25

we-ef

FLC301 Space frame

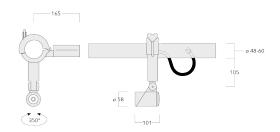

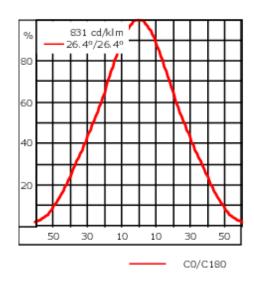

Specifications Material description

Body Marine-grade, die-cast aluminium alloy

Lens Safety glass lens

Colours RAL9004 Signal black

RAL9006 White aluminium
RAL9007 Grey aluminium

Gasket Silicone CCG® Controlled Compression Gasket

Fasteners PCS Polymer Coated Stainless Steel Hardware (unpainted)

Ingress protection IP66
Impact resistance IK07

Corrosion resistance 5CE+Primer

Electrical description

Driver / Ballast Integral EC electronic converter in thermally-separated compartment

Additional information

Lifetime Ta=25° L90B10 > 90000h





Control

1-10 V analogue dimming interface

Description	Part ID	С
1-10 V analogue dimming interface	430-0011	90

DALI interface

430-0013	DALI variant. The luminaire is equipped with a DT6 Dali driver (Dali 2.0).
	Dali 2.0
	-Application controllers and Input devices defined
	-Single-masters and multi-masters allowed
	-Event priorities defined
	-Separate addressing & grouping from control gear
	Note: Mixing Dali 1 and Dali 2.0 drivers can cause problems because the addressing and the command scope has changed!
	450 0010

FLC301 Space frame



Optical Accessories

Linear spread lens

Description	Part ID	C1
Linear spread lens IO-180	145-7229	42.5



Wallwash lens

Description	Part ID (C1
Wallwash lens IO-20		42.5






FLC301 Space frame


Honeycomb louvre

Description	Part ID	C1
Honeycomb louvre IW	145-7231	42.5

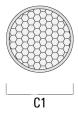

Glare shield

Description	ID A	C1
Glare shield ES	7232 20.5	58

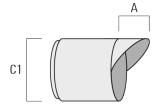

WE-EF LIGHTING Pty Ltd



FLC301 Space frame

Snoot

Description	Part ID	Α	C1
Snoot ET	145-7233	22.5	58

